


HMCS-B05K(H75VK)



Type: Double Cartridge Seal
 Replacement: Burgmann H75VK
 Temperature: -40°C to $+220^{\circ}\text{C}$
 Pressure: $\leq 4.0\text{Mpa}$
 Speed: $\leq 23\text{m/s}$
 Material: Q1,Q2,U2,T,V,M1,F,G,M

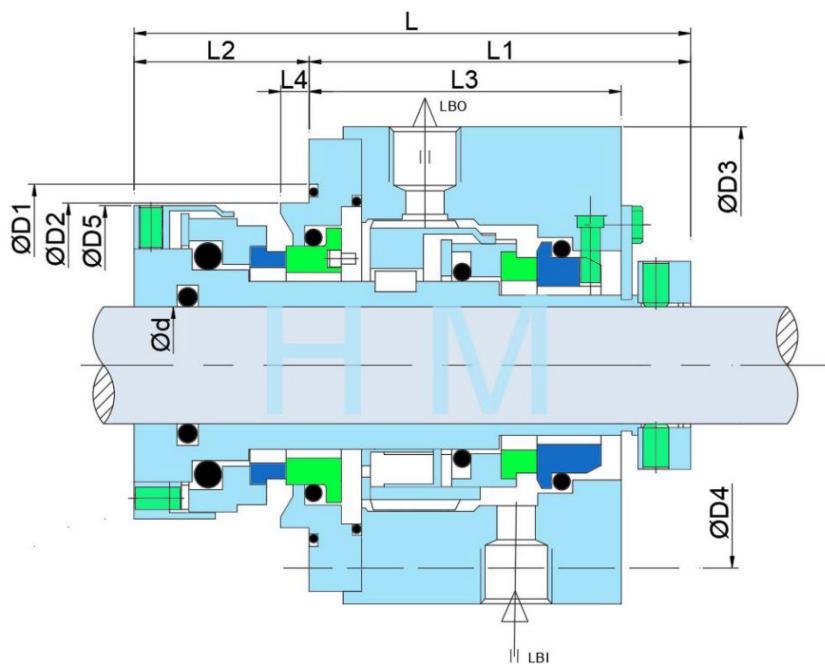

hengmi@mesel.com

d (mm)	D1	D2	D3	D4	D5	L	L1	L2	L3	L4
20	85	70	129	105	60	144.0	97.0	47.0	81.0	6.0
30	95	80	139	115	70	145.5	96.0	49.5	77.5	8.0
40	105	90	149	125	82	146.5	96.5	50.0	78.0	8.0
50	115	100	168	140	94	158.0	106.5	51.5	88.0	10.5
60	135	120	188	160	114	165.0	107.5	57.5	90.2	4.5
70	145	130	198	170	124	170.0	107.5	62.5	85.0	10.0
80	155	140	208	180	134	175.0	107.5	67.5	85.0	12.5
90	175	160	238	205	146	178.8	116.9	61.9	94.4	6.9
100	185	170	248	215	163	185.0	117.5	67.5	92.0	11.5
110	195	180	258	225	173	188.0	116.5	71.5	91.0	15.5